



## No DLLS were Found in the Waterfall Procedure Error in TM CAD

**Error:**

No DLLS were Found in the Waterfall Procedure

**Verification:**

Error message will appear and the Torchmate CAD software will not open.

**Cause:**

The issue is caused by files that are loaded on the PC when Go Pro Studio is installed. Deleting the following files does not harm or restrict the use of GoPro Studio so the application does not need to be removed.

**Solution:**

On the computer, navigate to C:\Windows\SysWOW64

Delete the following files:

- ippcore-6.1
- ippj-6.1
- ippjw7-6 .. 1
- IPPS-6.1
- ippvc-6.1

1

No DLLS were Found in the Waterfall Procedure Error in TM CAD  
DOC #:7219-0-US70-61118-DS-3-1

Rev#:00

Rev Date:06/12/18



**Cutting Systems**